


RENEWAL PARTS

IC2820-C100 RELAYS

Forms A, B, C, and D

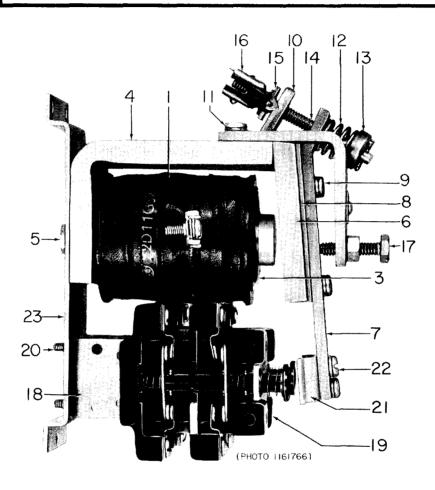

IC2820-C100B relay

NOTE:—When ordering parts for a form of the relay not covered by this bulletin, give reference number, description of part, complete nameplate reading, and above bulletin (GEF) number. Do not use catalog number when form for which the parts are needed is not covered by the bulletin.

When ordering renewal parts, give quantity, catalog number, description of each item required, and complete nameplate reading.



IC2820-C100 RELAYS

PARTS RECOMMENDED FOR NORMAL STOCK

Ref. No.		mber IC282	•		Catalog Number	Description		
	Α	В	С	D				
	1 1	1 1	1	1 2	6960053G3	Operating coil (see table below) Set of movable and stationary contacts with springs and contact-holding screws (For switch unit Cat. IC2956A200A, IC2956A200B and IC2956A200C)		
12	1	1	1	1	6960053G2 235184	Set of movable and stationary contacts with springs and contact-holding screws (For switch unit Cat. IC2956A200H) Compression spring for armature		

Ref. No. 1 - OPERATING COILS - 1 Required

NOTE: The operating coil is identified by the number following the form letter in the IC designation.

EXAMPLE:- IC2820-C100-A-2-B requires operating coil No. 2, Cat. No. 3245059.

Coil	Catalog	Coil	Catalog	Coil	Catalog	Coil	Catalog	Coil	Catalog		
No.	Number	No.	Number	No.	Number	No.	Number	No.	Number		
	FORMS A AND B										
2	\$3245059	6	\$3247657	10	‡22D13G7	14	‡22D13G8	18	‡22D13G5		
3	§3245060	7	§3248602	11	‡22D13G13	15	‡22D13G5	19	‡22D13G82		
4	\$3246873	8	§3248626	12	‡22D13G3	16	‡22D13G63	20	§3323120		
5	§3246 88 4	9	§33 2 3101	13	‡22D13G42	17	‡22D13G42	ľ	·		
	FORMS C AND D										
1	22D11G43	11	‡22D13G31	21	22D11G168	31	22D11G54	41	22D11G61		
2	22D11G44	12	‡22D13G32	22	‡22D13G7	32	3021124	42	¶2693247P15		
3	22D11G45	13	‡22D13G5	23	22D11G77	33	22D11G96	42	3028137		
4	22D11G46	14	‡22D13G38	24	22D11G136	34	22D11G100	43	¶2693247P34		
5	22D11G26	15	‡22D13G3	25	‡22D13G8	35	22D11G74	40	3241257		
6	22D11G47	16	‡22D13G82	26	‡22D13G39	36	‡3241953	44	¶2693247P1		
7	22D11G25	17	‡22D13G4	27	‡22D13G69	37	22D11G170	45	22D11G9		
8	22D11G48	18	‡22D13G7	28	‡22D13G63	38	3241960	46	22D11G75		
9	22D11G49	19	‡22D13G2	29	22D11G69	39	22D11G29	47	22D125G3		
10	22D11G50	20	‡22D13G13	30	22D11G55	40	22D11G86				

- \$ Requires copper jacket, Cat. No. 9092010.
- ‡ Requires copper jacket, Cat. No. 2494629.
- ¶ Edgewise wound copper.

COMPLETE LIST OF PARTS

Ref. No.	- 1	nber 1 IC282	-		Catalog Number	Description		
	Α	В	C	D	Number	r		
3	1	1	1	1	1445721	Retaining washer for operating coil		
4	1	1	1	1	9397583G1	Magnet frame with core		
4 5	1	1	1	1	N26P21012B	Screw fastening magnet core to base (1/4 in20, 3/4 in. hex. hd. slot, pro. fin.)		
	Δ	Δ	-	Δ	8626009P13	Lock washer between coil and magnet frame (To be used when copper jacket, Cat. No. 9092010 is furnished)		
	Δ	Δ	Δ	Δ	8626009P12	Lock washer between coil and magnet frame (To be used when copper jacket, Cat. No. 2494629 is furnished)		
6	1	1	1	1	9098152	Armature		
	1	1	1	1	9644941	Adjustable shim for armature		
	1	1	1	1	9098151	Stationary shim for armature		
	1	1	1	1	8058795	Clamp for shims		

Δ Quantity variable.

IC2820-C100 RELAYS

COMPLETE LIST OF PARTS (cont'd)

Ref.	101 102020-0100-			Catalog	Description		
No.	A	В	С	D	Number		
	2	2	2	2	N75P15010	Screw fastening shims and clamp to armature (8-32, 5/8 in. pan hd., brass)	
7	1	1	-	1 1	576A123P1	Support for armature	
7	-	-	1	-	1459971	Support for armature	
8	1	1	1	1 1	2453389	Guide strip between armature and support	
9	2	2	2	2	N144P16010C	Screw with lock washer fastening support and guide strip to armature	
10	1	1	1	1	9034493P1	Bracket for armature	
11	2	2	2	2	N144P16010C	Screw with lock washer fastening bracket to magnet frame	
12	1	1	1	1	235184	Compression spring for armature	
13	1	1	1	1	437972P1	Spring seat for compression spring	
14	1	1	. 1	1	125A4875P1	Adjusting screw for compression spring	
15	1	1	1	1	6955638	Support for adjusting screw	
16	1	1	1	1	9196760P1	Lock nut for adjusting screw	
17	1	1	1	1	N26P21016B	Stop screw for armature ($1/4$ in20, 1 in. hex. hd. slot, pro. fin.)	
18	1	1	-	1	723B245G7	Switch unit with mounting bracket (2 normally open contacts	
18	1	-	-	-	723B245G28	Switch unit with mounting bracket (1 normally closed contact)	
18	-	1	_	-	723B245G27	Switch unit with mounting bracket (1 normally closed contact)	
18	-	-	1	-	723B245G26	Switch unit with mounting bracket (1 normally open and 1 normally closed contact)	
18	-	-	-	1	723B245G8	Switch unit with mounting bracket (2 normally closed contacts)	
19	1	1	_	1 1	IC2956A200A	Switch unit only (2 normally open contacts)	
19	1	1	-	-	IC2956A200H	Switch unit only (1 normally closed contact)	
19	-	-	1	-	IC2956A200C	Switch unit only (1 normally open and 1 normally closed contact)	
19	-	-	-	1	IC2956A200B	Switch unit only (2 normally closed contacts)	
	1	1	1	2	6960053G3	Set of movable and stationary contacts with springs and contact-holding screws (For switch unit Cat. No. IC2956A200A, IC2956A200B, and IC2956A200C)	
	1	1	-	-	6960053 G2	Set of movable and stationary contacts with springs and contact-holding screws (For switch unit Cat. No. IC2956A200H)	
20	4	4	2	4	576A145P4	Screw fastening switch unit to base	
21	1	1	-	1	576A117P1	Operating arm for switch unit	
	-	-	1	-	576A118P1	Operating arm for switch unit	
22	2	2	-	2	N144P16008C	Screw with lock washer fastening operating arm to armature support	
	-	-	2	-	N75P15006	Screw fastening operating arm to armature (8-32, 3/8 in. pan hd., brass)	
23	1	1	-	1	576A112P1	Base for relay	
23	-	-	1	_	576A113P1	Base for relay	

GENERAL ELECTRIC COMPANY
INDUSTRIAL CONTROL PRODUCTS DEPARTMENT
SALEM, VA. 24153

